

Overview

The proper ball joint inspection procedure is based on the type of ball joint installed on these vehicles. Many times the ball joint may be replaced unnecessarily due to improper ball joint inspection procedure. This bulletin discusses the proper inspection procedure per ball joint design.

Models affected:

Year	Application
1971-1998	Full Size Dodge Ram (B-Series) Van (B1, B2, B3; B1500, B2500, B3500)

Inspection Procedure

Inspection procedures depend on the type of ball joint installed on the vehicle, so it's important to determine the type/style of ball joint installed.

Figure 1



indicator (see Figure 1), the appropriate inspection procedure is as follows:

'Be Car Care Aware

Con't next column

OE Style Ball Joint (con't)



Lift the vehicle so that the weight of the vehicle is off the ball joint. This can be accomplished with a standard hydraulic floor

jack. Connect a dial indicator, attaching it between the lower suspension arm and the steering knuckle. If the vertical movement is more than .020," the ball joint should be replaced.



Norma

Worn

Wear Indicator Ball Joint

The most common type of wear indicator has a small boss that protrudes from the center of the lower housing. As wear occurs this boss will recede into the housing.

When it is flush, or receded into the cover plate, the ball joint should be replaced.

When inspected, wear indicator ball joints must remain loaded, with the vehicle resting on the tires to check for wear. The vehicle should be checked at curb height (normal running position).



Con't next column

Wear Indicator **Ball Joint** (con't)





Worn **Boss Receded**

Good Boss Protruding

Note 1: When using the OE ball joint inspection method on a wear indicator ball joint, the rubber cushion that acts as a preload device will collapse and give the indication of a worn ball joint through excessive play and/or a receded boss. Wear Indicator ball joints must be visually inspected only, with the normal vehicle load on the ball ioint.

Note 2: Wear Indicator ball joints will most likely have an off-center grease (zerk) fitting see Figure 1. THIS IS NORMAL and should not be considered evidence of a worn or defective ball joint.

Repair Procedure

If either method of inspection determines that the ball joint is worn or faulty, be sure to replace with the MOOG Problem Solver K7053T ball joint. This

redesigned ball joint is an OE type (non-wear indicator) unit, designed for long life and dependability.

UPDATED K7053T BALL JOINT

www.moogproblemsolver.com

FEDERAL-MOGUL MOTORPARTS

©2015 Federal-Mogul Motorparts Corporation. NASCAR is a registered trademark of NASCAR, Inc. MOOG and The Problem Solver are trademarks owned by Federal-Mogul Corporation, or one or more of its subsidiaries, in one or more countries. All other trademarks are the property of their respective owners. All rights reserved.